

Shenandoah Construction
 1888 NW 22nd Street
 Pompano Beach FL 33069
 954-975-0098
 help@shenandoahconstruction.com
 shenandoahconstruction.com

Inspection Report / Inspection: 1


Date 4/5/2019	WO / PO. No. 13481	Weather Dry	Surveyor's Name AGUSTIN	Pipe Segment Reference	Section No. 1
LS No. N/A	Project Name STORM WATER INSPECT	Customer TOWN OF LAKE PARK	Date Cleaned 4/5/2019	Pre-Cleaning Jetting	Pipe Shape Circular

Street 123	City LAKE PARK	Use of Sewer Stormwater	MH Depth 6'7"	Upstream MH CB 12-013D	Downstream MH CB 12-012D
Flow Control Plugged	Location Code Light highway	Flow Control Plugged	TV'd Length 619.50 ft	Dir. of Survey Downstream	Measured Length 619.50 ft

Purpose of Survey Infiltration/Inflow Investigation	Pipe Width 54.00 inch
Vehicle # TV 353	Dia./Height Reinforced Concrete Pipe
Shenandoah Job # 050419_1	Material Reinforced Concrete Pipe
Media No. 050419_1	Lining Method

Add. Information : **PRE TV**

1:864	Position	Code	Observation	MPEG	Photo	Grade
	0.00	AMH	Upstream Manhole, Survey Begins / CB 12-013D	00:00:00		
	10.90	IR	Infiltration Runner, from 03 to 08 o'clock, within 8 inches of joint: YES	00:03:33	1_2A	M 4
	22.20	IR	Infiltration Runner, from 05 to 08 o'clock, within 8 inches of joint: YES	00:04:42	1_3A	M 4
	192.60	IG	Infiltration Gusher, from 05 to 09 o'clock, within 8 inches of joint: YES / WITH SAND	00:11:16	1_4A	M 5
	200.50	IR	Infiltration Runner, from 04 to 09 o'clock, within 8 inches of joint: YES / WITH SAND	00:12:10	1_5A	M 4
	215.90	IR	Infiltration Runner, from 03 to 09 o'clock, within 8 inches of joint: YES / WITH SAND	00:14:34	1_6A	M 4
	238.90	IR	Infiltration Runner, from 04 to 08 o'clock, within 8 inches of joint: YES / WITH SAND	00:16:06	1_7A	M 4
	245.70	IG	Infiltration Gusher, from 04 to 08 o'clock, within 8 inches of joint: YES / WITH SAND	00:17:19	1_8A	M 5
	262.10	IR	Infiltration Runner, from 03 to 07 o'clock, within 8 inches of joint: YES / WITH SAND	00:20:01	1_9A	M 4
	270.10	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES / WITH SAND	00:21:12	1_10A	M 4
	277.80	IR	Infiltration Runner, from 04 to 06 o'clock, within 8 inches of joint: YES	00:22:11		M 4
	308.40	IR	Infiltration Runner, from 03 to 09 o'clock, within 8 inches of joint: YES	00:24:21		M 4
	324.60	IR	Infiltration Runner, from 04 to 08 o'clock, within 8 inches of joint: YES	00:25:13	1_13A	M 4
	331.50	IR	Infiltration Runner, from 05 to 09 o'clock, within 8 inches of joint: YES	00:25:44		M 4
	339.10	IR	Infiltration Runner, from 04 to 10 o'clock, within 8 inches of joint: YES	00:26:31		M 4

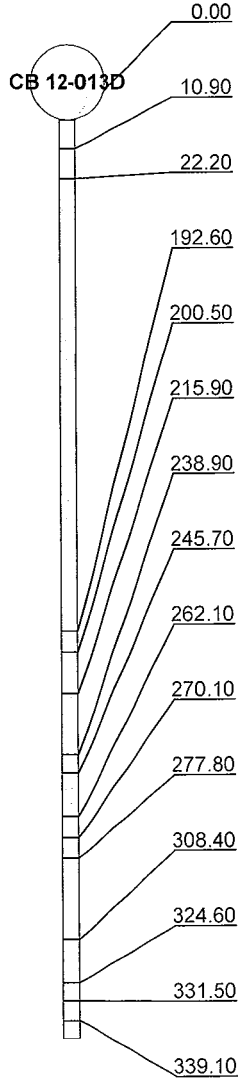

City :
Tel:
Fax:
Email:

Inspection Report / Inspection: 1

Date :	Job number :	Weather : Dry	Operator : AGUSTIN	Counter : 1	Section name :
Present :	Vehicle :	Camera :	Preset :	Cleaned : Jetting	Rate :

1:864	Position	Code	Observation	MPEG	Photo	Rate
	<u>370.70</u>	IG	Infiltration Gusher, from 04 to 07 o'clock, within 8 inches of joint: YES / WITH SAND	00:28:24	1_16A	M 5
	<u>378.10</u>	IR	Infiltration Runner, from 04 to 09 o'clock, within 8 inches of joint: YES	00:29:32		M 4
	<u>385.20</u>	IR	Infiltration Runner, from 03 to 08 o'clock, within 8 inches of joint: YES / WITH SAND	00:30:03	1_18A	M 4
	<u>393.50</u>	IR	Infiltration Runner, from 04 to 07 o'clock, within 8 inches of joint: YES	00:30:43		M 4
	<u>401.90</u>	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES	00:31:30		M 4
	<u>424.50</u>	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES	00:33:05	1_21A	M 4
	<u>439.90</u>	IR	Infiltration Runner, from 03 to 08 o'clock, within 8 inches of joint: YES	00:34:25		M 4
	<u>470.30</u>	IR	Infiltration Runner, from 03 to 07 o'clock, within 8 inches of joint: YES / WITH SAND	00:36:51	1_23A	M 4
	<u>477.70</u>	IR	Infiltration Runner, from 03 to 07 o'clock, within 8 inches of joint: YES	00:39:29		M 4
	<u>501.20</u>	IR	Infiltration Runner, from 03 to 07 o'clock, within 8 inches of joint: YES	00:40:36		M 4
	<u>524.30</u>	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES	00:41:45		M 4
	<u>532.10</u>	IG	Infiltration Gusher, from 05 to 07 o'clock, within 8 inches of joint: YES / WITH SAND	00:42:32	1_27A	M 5
	<u>539.70</u>	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES	00:43:31		M 4
	<u>555.30</u>	IR	Infiltration Runner, from 06 to 08 o'clock, within 8 inches of joint: YES	00:44:31		M 4
	<u>563.00</u>	IR	Infiltration Runner, from 03 to 06 o'clock, within 8 inches of joint: YES	00:44:58		M 4
	<u>619.50</u>	AMH	Downstream Manhole, Survey Ends / CB 12-012D	00:48:59		

QSR	QMR	SPR	MPR	OPR	SPRI	MPRI	OPRI
0000	544D	0	120	120		4.14	4.14

